






Product Description:

BatPac™ 1800mm 73W Batten

Introducing BatPacTM. This product provides over 40% energy savings compared to traditional fluorescent, however provides the direct replacements for single or twin fittings in size and output. Can also be surface mounted or suspended.

| SKU Code | Wattage | Colour | Lumens | Lumens/Watt | Beam Angle | Finish Colour | SKU Type |
|------------------|---------|--------|--------|-------------|------------|---------------|------------------------|
| EN-BA1873/40 | 73 | 4000 | 9100 | 125 | 120 | White | Non Dimmable |
| EN-BA1873EM/40 | 73 | 4000 | 9100 | 125 | 120 | White | Emergency |
| EN-BA1873EMMS/40 | 73 | 4000 | 9100 | 125 | 120 | White | Emergency Microwave |
| EN-BA1873MS/40 | 73 | 4000 | 9100 | 125 | 120 | White | Microwave |



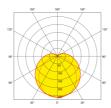



Feature & Benefits

- Opal polycarbonate diffuser
- Knockouts for cable entry on both ends
- IK08 rated impact resistance
- Push-fit terminals and clip-in gear tray for fast installation
- Multiple BESA mounting points (matches traditional fluorescent
- Adjustable light detector from 2-50 lux for microwave option
- Adjustable hold time 5 secs to 30 mins for microwave option
- 5 year warranty
- 3 year onsite warranty (registration required) *Terms and conditions apply

Product Specs:

| Input Voltage | 220~240V AC |
|--------------------------|-------------|
| Power Factor | 0.9 |
| Lifetime L70 (hrs) | 50000hrs |
| Lamp Base | Other |
| Length (mm) | 1734 |
| Height (mm) | 71 |
| Operating Temp. (Min) °C | -20°C |

| Input Frequency | 50/60HZ |
|--------------------------|---------|
| IP Rating | IP20 |
| IK Rating | IK08 |
| Width (mm) | 61 |
| Weight (Kg) | 1.813 |
| Product Type | Linears |
| Operating Temp. (Max) °C | 45°C |

Compliance & Approvals:













Warranty:

This product has a warranty period of 5 Years. Warranties may be available on certain products as indicated in the product description. Warranties are valid from the date of purchase. The warranty is invalid in the case of improper use, installation, tampering, removal of the Q.C. date label or installation in an improper working environment or installation. Should this product fail during the warranty period it will be replaced free of charge, subject to the correct installation of the original product and subsequent return of the faulty unit. Aurora does not accept responsibility for any installation costs associated with the replacement of this product and Aurora reserves the right to alter specifications without prior notice.